


Fixing the communication to a Single Channel Receiver

The following explains how to ensure that the Single Channel Receiver can communicate with the Genius hub.

When a Single Channel Receiver has no valid paths of communication back to the Genius Hub it can no longer accurately control the boiler, zone valve or underfloor heating zone to the schedule on the app. This can lead to the heating being on when should be off and vice-versa.

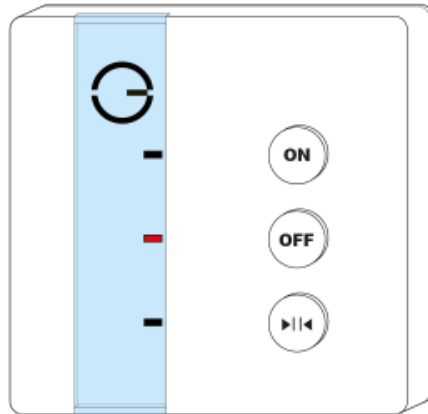


First locate the Single Channel Receiver which is not communicating with the Genius Hub. The number of the Single Channel Receiver may be located on the right hand side of the device.

First the Genius Hub needs to attempt to communicate with the Single Channel Receiver once more.

First, ping the device:
Select the Single Channel Receiver you want to check
Click on the Device sub-menu (3 dots)
Select Ping and confirm

Wake up the device by Pressing and holding the bottom button for 3 seconds.

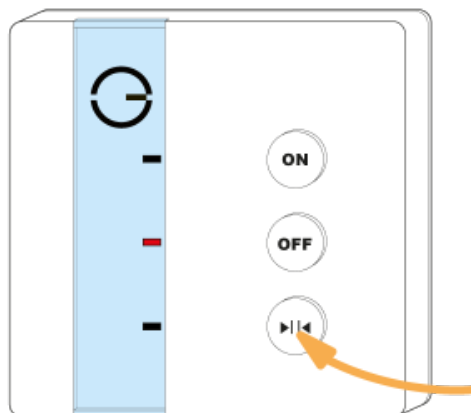

The Hub will check that the Single Channel Receiver received the ping

If the ping failed to get through:

If the Single Channel Receiver is still not communicating then is not able to find a route back to the Genius Hub.

There are a number of possible option to fix this:

1. Ensure all of your other Smart Plugs are plugged in and powered on. These act as signal repeaters and if unplugged may stop any nearby devices from managing to contact the Genius Hub.

2. Move an existing Smart Plug closer to the Single Channel Receiver. Moving a device which repeats the signal closer is likely to provide a new route back to the Genius Hub. If you have thick walls (or other materials which may block the signal like a metal cabinet or large piece of furniture) the Smart Plug may only be able to communicate through 1 wall in that direction.

Note: If you move a Smart Plug too far from its prior position, you may reduce the options for another device which needs to communicate with the Genius Hub.

3. Purchase a new Smart Plug to place near to this device. If you have a signal 'dead-spot' and cannot move another Genius Smart Plug closer without adversely affecting the signal coverage elsewhere in the property a new Smart Plug will be needed to provide a suitable route back to the Genius Hub.

Once you have carried out the above options (one at a time and in turn), try the previous step once more to see if the device can now communicate with the Genius Hub.