


# Genius Radiator Valve error codes

There is an error code showing on the Genius Radiator Valve

The Genius Radiator Valve normally displays the set temperature under normal operation. However as there is a screen, we choose to display device problems on the screen of the device.

If you see a code on the valve that is not a temperature then there may be a problem.

The error codes (DA-WRV-E)

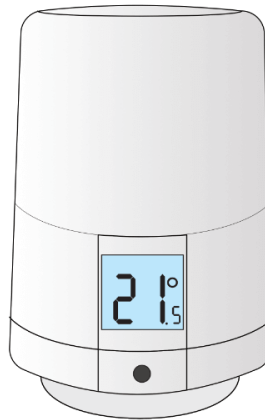


The error codes are as follows:

- **E1** - Top temperature sensor has a problem
- **E2** - Side temperature sensor has a problem
- **E6** - Motor has a problem
- **E8** - Communication error
- **E9** - Valve cannot close

## E1, E2 & E6 errors

1. Remove and replace the batteries in the Genius Radiator Valve as described in [this article](#).
2. When the Genius Radiator Valve has restarted, if the error has persisted the device has developed a fault and needs to be replaced. Contact Genius Hub if your device is [under warranty](#).

## E8 error

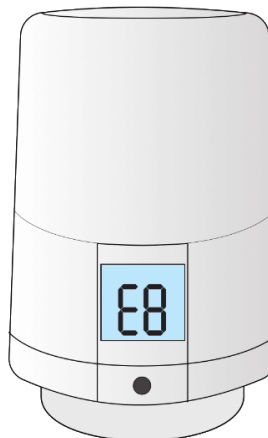


The Genius Radiator Valve shows the 'E8' 'communication error' if it tries to communicate with the Genius Hub a number of times and fails.

The Genius Radiator Valve will naturally come out of 'E8' when the communication with the Genius Hub is re-established, through the only tries to communicate with the Genius Hub about every 30 minutes when in 'E8' so this may take a number of hours.

To remove the 'E8' error from the valve immediately, so you can change the temperature on the valve, you have to remove one of the batteries for 30 seconds and put it back in again. This communication problem may have been caused if a Genius Smart Plug near the valve has become unplugged or the Genius Hub has been turned off.


If the problem persists see the article: [How to - Genius Position the Genius Smart Plugs](#).

## E9 error

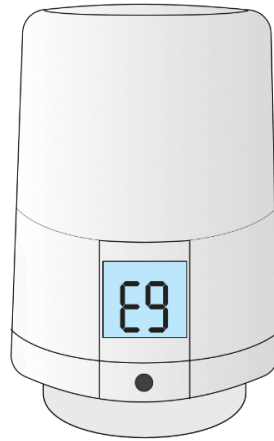

The Genius Radiator Valve shows the 'E9' 'Valve closing error' if it tries to close the flow of water through the radiator a number of times and fails. Unmount and remount the Genius Radiator Valve to see if this fixes the problem.

## The error codes (DA-WRV-C)

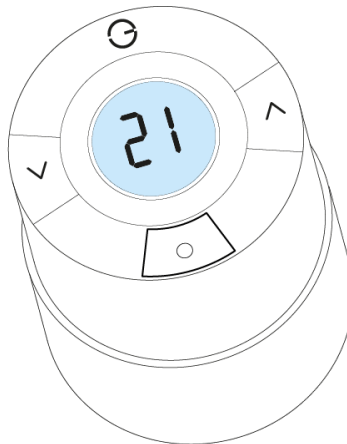


The error codes are as follows:

- **E1** - Front temperature sensor has a problem
- **E2** - Back temperature sensor has a problem
- **E3** - Motor has a problem
- **E5** - Communication error

## E1-E3 errors

1. Remove and replace the batteries in the Genius Radiator Valve as described in [this article](#).
2. When the Genius Radiator Valve has restarted, if the error has persisted the device has developed a fault and needs to be replaced. Contact Genius Hub if your device is [under warranty](#).

## E5 error

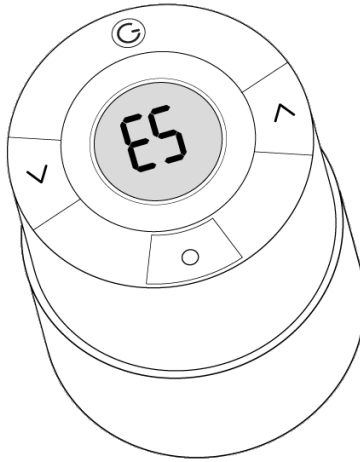

The Genius Radiator Valve shows the 'E5' 'communication error' if it tries to communicate with the Genius Hub a number of times and fails.

The Genius Radiator Valve will naturally come out of 'E5' when the communication with the Genius Hub is re-established, through the only tries to communicate with the Genius Hub about every 30 minutes when in 'E5' so this may take a number of hours.

To remove the 'E5' error from the valve immediately, so you can change the temperature on the valve, you have to remove one of the batteries for 30 seconds and put it back in again. This communication problem may have been caused if a Genius Smart Plug near the valve has become unplugged or the Genius Hub has been turned off.

If the problem persists see the article: [How to - Genius Position the Genius Smart Plugs](#).

## Related Information:

- [How to - Remove and refit the Genius Radiator Valve](#)
- [Is my Genius Radiator Valve working correctly?](#)
- [Genius Radiator Valve responding slowly to change in temperature on the app](#)
- [Adjustments you can make with our Genius Hub Devices to fine tune your setup](#)
- [Controlling a Plinth Heater](#)